

STARTER KIT (GR26099)

**MODELS : G260PUM/G260PUH
G231PUM/G231PUH**

1. Subject

Recently, we found that there was a wrong part in the Starter Kit (GR26099). They were made on March 11th in 2014. The Reel in the Recoil was different from standard.


Please check the stamp on the Reel. If you found the stamp number "40311", please let us know. We would like to exchange to the correct Recoil (848ESZ7510). With the wrong part, the dumper spring may be bent and it makes hard to start.

Your estimate purchase date : April or May in 2014

NOTE: The Recoil of the spare part has no this matter.

2. Check points

Please check the stamp on the Reel in the Recoil.

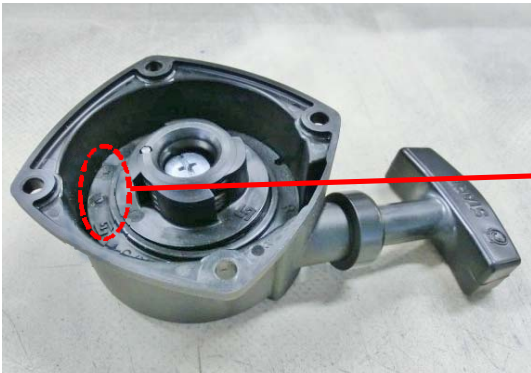

If the stamp is "40311", that is with wrong part.
If the other numbers, they are the O.K.

Correct Reel

Wrong Reel



Reel P/N: 848E4075C0

